

SERVO-DRIVE uno

for bottom mount and top mount waste bin solutions


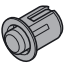
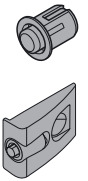
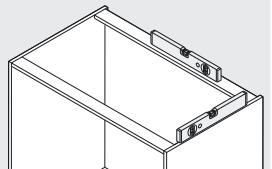


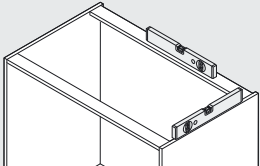
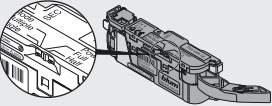
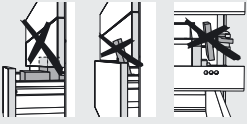
Problem resolution



SERVO-DRIVE uno:  <http://servodrive.blum.com/uno>

We recommend the following troubleshooting sequence.

Problem	Possible cause	Remedy	
1 Pull-out will not open.	Cabinet profile is positioned incorrectly.	➤ Correct installation position of cabinet profile.	
	The pull-out back is bent.	➤ Straighten pull-out back.	
	Pull-out is blocked by an object.	➤ Remove object.	
1.1 Pull-out will not open. There is no 2 mm bumper path.	No Blum spacing bumper is installed.	➤ Front height is smaller than 300 mm: Install 1 Blum spacing bumpers. ➤ Front height is larger than 300 mm: Install 2 Blum spacing bumpers.	
	Standard bumpers are still in the front.	➤ Remove standard bumpers from front. ➤ Install attached Blum distance bumpers in the cabinet.	
1.2 Drive unit operating mode display does not light up.	Drive unit is not connected properly.	➤ Reconnect drive unit and activate eject lever.	
	Drive unit is defective.	➤ Reconnect drive unit and activate eject lever. ➤ Replace drive unit and activate eject lever.	
1.3 The operating mode display on the Blum transformer does not light.	Switched outlet is turned off	➤ Make sure that the outlet is turned on.	
	Blum transformer is not connected to the outlet.	➤ Make sure that the flex is plugged into the outlet.	
2 Pull-out opens rapidly to full extent & bangs on the stop.	Cabinet is not aligned horizontally.	➤ Realign cabinet.	

Problem	Possible cause	Remedy	
3 Pull-out will not open deep enough.	Cabinet is not aligned horizontally.	➤ Realign cabinet.	
	Drive unit: Selector switch "Power" is set incorrectly.	➤ Set selector switch "Power" to "Full".	
	Runner system is difficult to open and close.	➤ Clean cabinet profile. ➤ Replace cabinet profile.	
	Drive unit is defective.	➤ Reconnect drive unit and activate eject lever. ➤ Replace drive unit and activate eject lever.	
4 Pull-out opens again on its own when closing.	Bracket profile and/or attachment bracket is positioned incorrectly.	➤ Correct position of bracket profile and/or attachment bracket.	
	Drive unit is defective.	➤ Replace drive unit and activate eject lever.	
	Cabinet profile is defective.	➤ Replace cabinet profile.	
5 Pull-out will not fully close.	Pull-out is blocked by an object.	➤ Remove object.	
	Bracket profile and/or attachment bracket is positioned incorrectly.	➤ Correct position of bracket profile and/or attachment bracket.	
	Drive unit is positioned incorrectly.	➤ Correct position of drive unit.	

Julius Blum GmbH
Furniture Fittings Mfg.
6973 Höchst, Austria
Tel.: +43 5578 705-0
Fax: +43 5578 705-44
E-mail: info@blum.com
www.blum.com



MA-504-505/1-S-EN 05.13